



Inspection Report

Report Date	5/6/2015	
Company	Northeast Resource Group Inc.	Customer
Address	95 Court Street Plymouth, MA 02360	Site Address
Thermographer	Mark Parquette	Contact Person

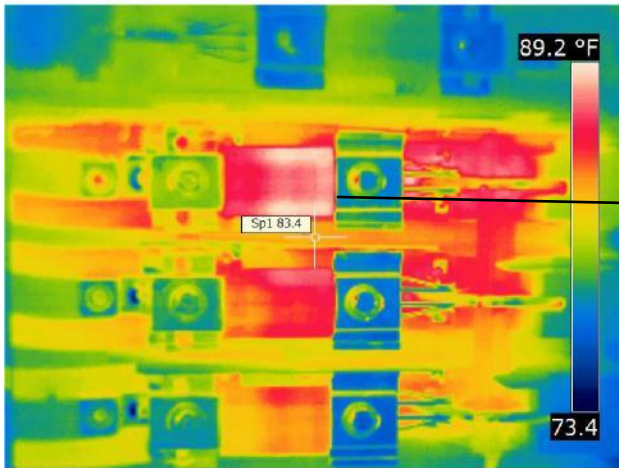


Image and Object Parameters Text Comments

Camera Model	FLIR T360_ Western
Image Date	5/2/2013 8:53:05 AM
Image Name	IR_0069.jpg
Emissivity	0.95
Reflected apparent temperature	68.0 °F
Object Distance	3.3 ft

Description

Location: MAIN ELECTRICAL ROOM
 Target: MAIN GEAR - SECTION 4 -1LC SWITCH

Comment: Temperature delta between fuses as well as load and line side of L1 indicates a possible issue with the fuse holder and/or connection. This switch should be shut down and completely inspected and corrected as needed during the shutdown.